

GUNITE Service Bulletin

Problems with Motor Wheel Brake Drums

This bulletin is to inform you of recent field problems concerning 87295 Motor Wheel brake drum. By using some interchange listings, 87295 can be crossed to a Gunite 3543. The 87295 Motor Wheel brake drum is used on a Mack S34C or S38C axle with a 88462 Motor Wheel hub. The 88462 Motor Wheel hub has a hub outside diameter that is greater than competitive hubs. The 3543 Gunite brake drum is a Navistar application only.

The correct Gunite brake drum to be used with 88462 Motor Wheel hub is a Gunite 3699 brake drum.

WARNING:

Gunite brake drums 3543, 3293 and 3416 should NOT be used on a Mack S34C or S38C application with a Motor Wheel hub 88462. These brake drums will NOT fit over the Motor Wheel hub. If mounted, premature failure WILL occur due to improper fit and interference, resulting in drum breakage.